

1



Donning the Device & Closing the Chest Strap

- Don device with shoulder straps fully extended.
- Close the chest strap.

6



Checking the Alarm Function

- Activate flushing mode of demand valve.
- Watch pressure gauge. Warning signal must sound at 55 ±5 bar.

2



Tightening the Shoulder Straps

- Tighten shoulder straps until back plate fits comfortably.

7



Donning the Mask

- Spread the mask head harness with both hands and place chin into chin stop.


3



Closing the Hip Belt

- Close hip belt and tighten loose ends towards the back.

8

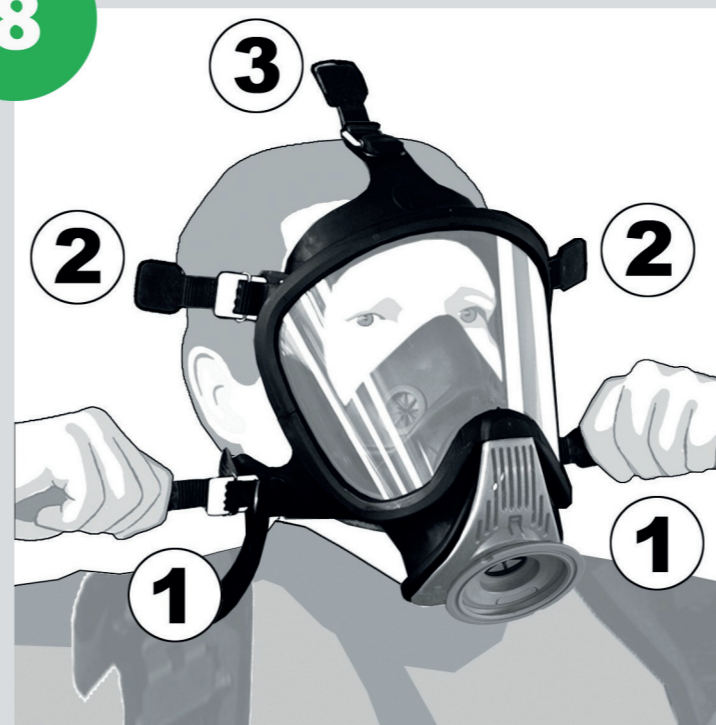

Tightening the Straps

- Pull harness over head
- Tighten straps starting with neck straps
- Temple straps and finally forehead strap.

4



Adjusting the Shoulder Straps

- Adjust shoulder straps to achieve a comfortable weight distribution between shoulder straps and hip belt.


9



Leak Test

- Cover the connector opening with the palm of the hand.
- Inhale and hold the breath, no air shall leak in.

5

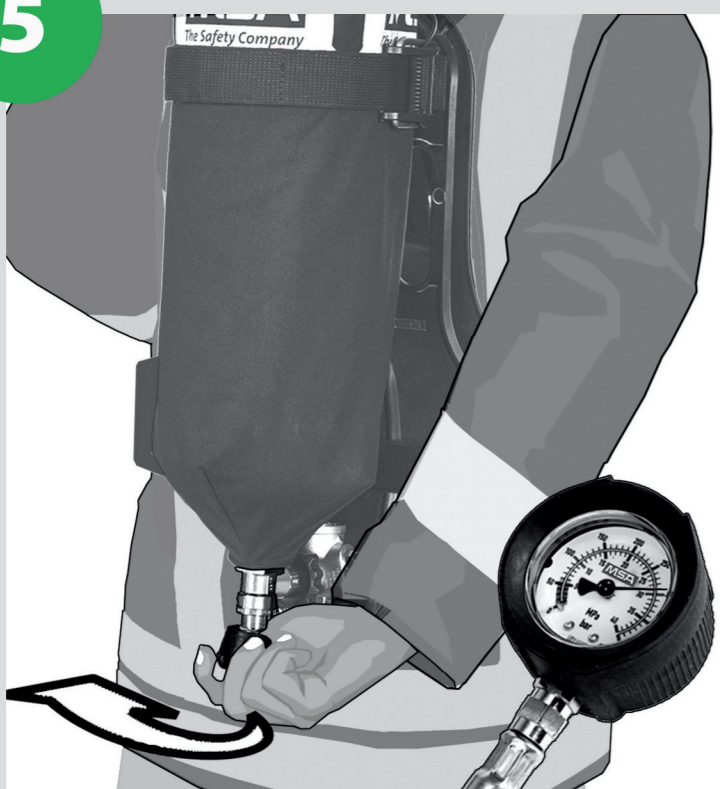

Checking the Pressure

- Push red button to close demand valve.
- Open cylinder valve and check pressure.
- For 300 bar cylinders: min. 270 bar
- The pressure must not drop more than 10 bar in 60 seconds.

10



Connecting the Demand Valve

- Insert the demand valve into the adapter of the mask until it distinctly snaps.
- Inhale to activate; the SCBA is now ready to use.